

**TrueGuard™ is for use on 12vdc systems only.**


1. Unpack the monitor, with integrated wire harness, and antenna. Take a moment to inspect all components to verify there is no shipping damage.
2. Place the antenna vertically on the roof of the generator and route the antenna cable into the area of the generator control. The antenna used for transmitting must be installed to provide a separation distance of at least 20 cm from all persons and must not transmit simultaneously with any other antenna transmitters. BE SURE to provide a drip loop lower than the monitor to keep water from running down the antenna cable into the monitor connection.
3. Attach the monitor via its magnetic feet, on top of the engine controller or other appropriate location. Horizontal surfaces are best, but the unit may be mounted vertically or even upside down if necessary. *Note: If mounted vertically, install the monitor with the cables down to prevent water from entering the enclosure.*
4. Route the wire harness into the generator control enclosure.
5. The monitor wires directly to the DEC3 control board using the wiring definitions shown in *Table 1*.
6. The Kohler DEC3 installation is completed by making connections to the terminal strips on the main board. The alarm condition connection points are on TB1 (long terminal strip) and the remote start terminals are on TB2 (short terminal strip). Power for the monitor comes from TB1 Terminal 42A. Be aware that this is a FUSED terminal point, and on occasion, the fuse for that terminal may be blown. After connecting the monitor, ALWAYS verify the voltage between terminals 2 (GND) and 42A (B+ = 12 VDC).
7. Attach the antenna cable to the front of the monitor, and tighten thumb tight.
8. Allow 15 minutes for the monitor to log into the network and then call OmniMetrix at 770-209-0012 to confirm installation. Access to machine data is through the OmniView® web interface at [www.omnimetrix.net](http://www.omnimetrix.net). Contact OmniMetrix for login instructions and web training



TrueGuard-2 System



Kohler DEC3 Controller

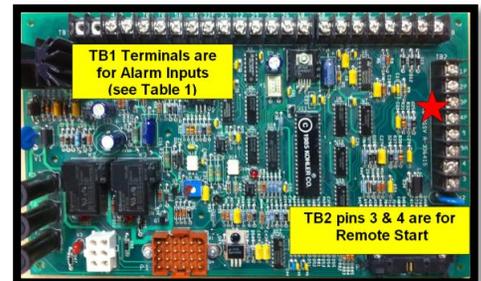

DEC3 Control Board

WIRING TABLE		
OMN WIRE	FUNCTION	KOHLER TERMINATION
Red	Power In (12 Vdc)	42A or other Genset B+
Black	Ground	2
Orange	Running Input	Hour Meter + Terminal
Blue	Common Fault Input	32 or 32A
Violet	Not in Auto Input	80
Gray	Over Crank Input	12
White/Yellow	Remote Start (Relay A)	3 (Remote Start)
White/Brown	Remote Start Relay B	4 (Remote Start)

**Table 1 – Kohler DEC 3 Wiring**

### LED Behavior:

The BLUE LED will illuminate at boot up (stay on). The LED will start blink rapidly, on/off every 1/2 second, once the modem is connected to an available tower. The LED will begin to blink more slowly, three seconds on, three seconds off, once the modem has connected to the OmniMetrix server. Note: The BLUE LED is an indication of network service. If it continues to stay illuminated (on), please check the SIM card, antenna, and signal strength.

The Red LED illuminates approximately 20 seconds after the Blue LED illuminates. A solid Red LED indicates the unit is trying to log into our server.

After approximately 20 seconds, Red LED turns off and the Green LED illuminates for 3 seconds. This indicates the unit has logged into our server.

The Red LED or Green LED flashes after login: Short Green LED flashes indicate the monitor is getting data; Long flashes of the Red LED indicate failure.

**Signal Strength:** LED signal strength indication is provided at login and routinely during operation, using the Red & Green LED's as follows:

1. The Red & Green LED's flash rapidly for 2 seconds to indicate the beginning of the "Signal Strength" routine.
2. Next, the LED(s) will stay fully illuminated 2 seconds to indicate the current signal strength:
  - a. Solid Red LED only = below 10
  - b. Solid Red & Green LED's = 10~60
  - c. Solid Green LED only = greater than 60.
3. To complete the Signal Strength cycle, the Red & Green LED's flash rapidly again for 2 seconds, then stop (end of cycle).

**If you have any questions, please call OmniMetrix Tech Support at 770-209-0012 or email at [techsupport@omnimetrix.net](mailto:techsupport@omnimetrix.net).**